

Subject: FS65 Wear Plate For Floor Covering Under Accelerator Pedal

Carolina Thomas Bus Buzz #34 is providing information and instructions for adding a wear plate under the accelerator pedal on FS65's.







A county reported that the flooring under the accelerator pedal was wearing after years of service. This Service Solution provides directions to add a wear plate. These buses are not under warranty but Carolina Thomas has been given the plates and we will provide these at no charge as well as the repair instructions. Each County will receive these plates with one of your parts shipments.

Service solution SS3 is included here and also available on www.thomasbusonline.









BODY

MODEL: FS-65

SUBJECT: ACCELERATOR PEDAL WEAR PLATE INSTALLATION

PAGE: 1 OF 2 INDEX: SS 3

BULLETIN: 2

IMPORTANT: READ ENTIRE PROCEDURE BEFORE BEGINNING.

- 1. Chock the tires and be sure the ignition key is in the "Off" position.
- Place the wear plate TBB 165669 under the accelerator pedal where it contacts the floor.Center the plate, where contacted by the pedal, at 50% throttle. Mark the hole locations on the floor.
- Remove the accelerator pedal. Confirm the plate is centered over the pedal wear print in the floor cover.
- 5. Drill marked locations with a #22 drill (0.157).
- Install plate using four (4) TBB 69003182 #10 X 0.75 flat head screws.





Service Solution





Page: 2 of 2 INDEX: SS 3

BULLETIN: 2

7. Reinstall accelerator pedal and confirm proper pedal operation.



8. Remove tire chocks.

MATERIALS REQUIRED:

 PART NUMBER
 QTY.
 DESCRIPTION

 TBB 165669
 1
 WEAR PLATE – ACCELERATOR PEDAL

 TBB 69003182
 4
 #10 X 0.75 FLAT HEAD SCREW





Each County will receive these plates with one of your parts shipments in the very near future.

Since this is not warranty this will save on freight costs.

Service solution SS3 is included here and also available on www.thomasbusonline.

